


Ausladung und Hubhöhe • Radius and hoisting height • Portée et hauteur de levage Sbraccio e altezza di sollevamento • Alcance y altura de elevación • Alcance e altura de elevação Вылет и Высота подъема

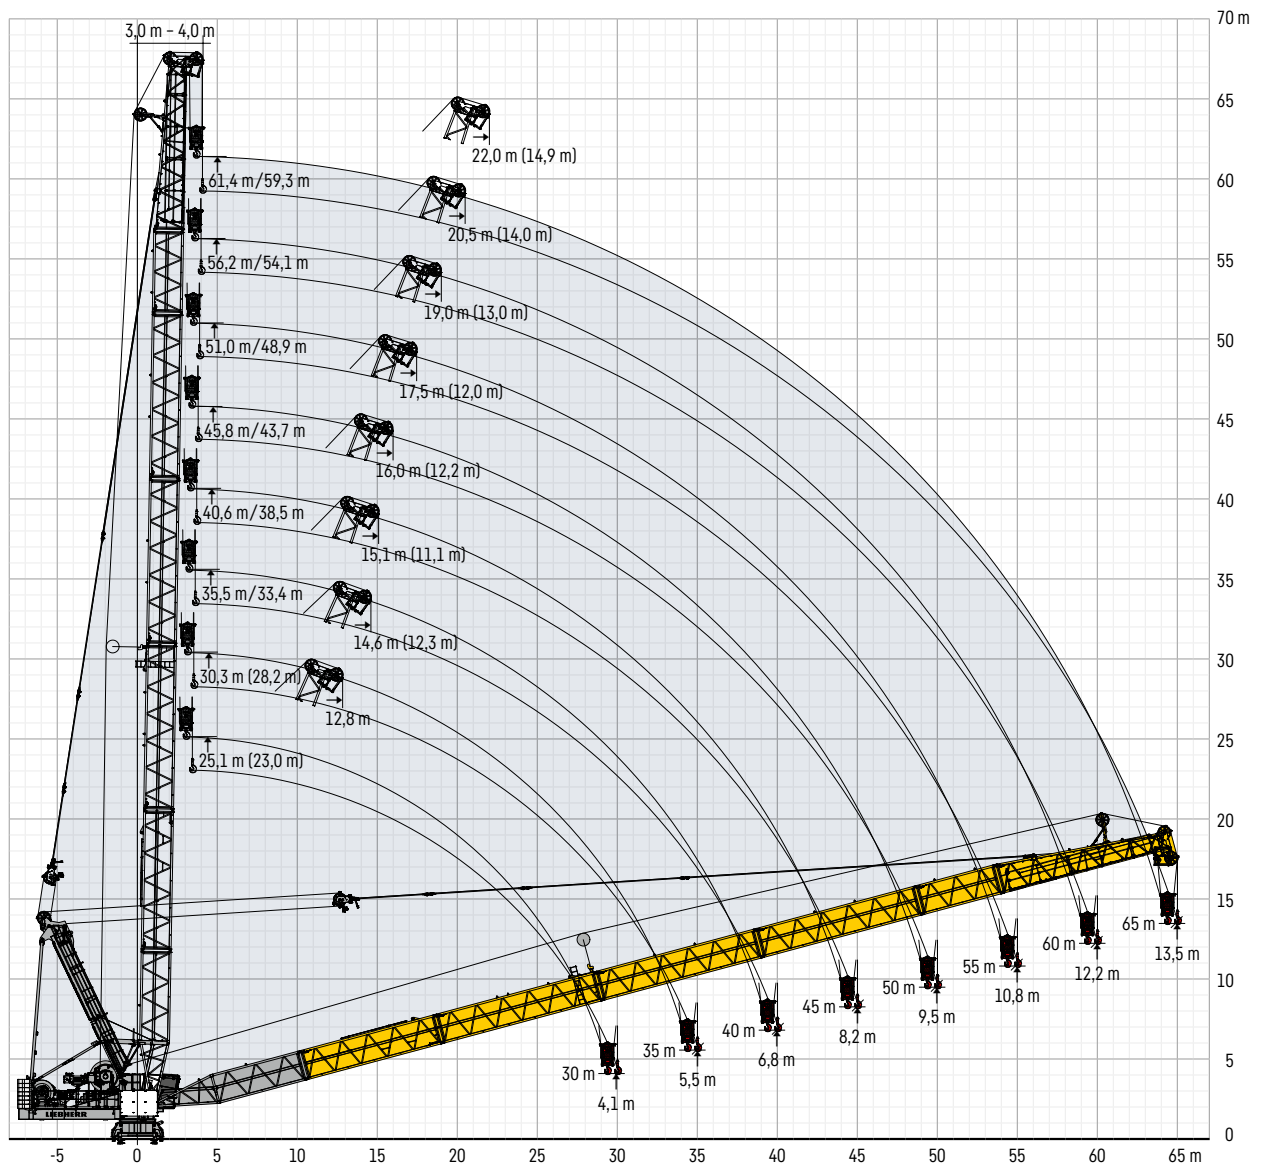

Minimum Ausladung außer Betrieb • Minimum radius out of operation • Portée minimum hors service • Sbraccio minimo fuori servizio • Alcance mínimo fuera de servicio • Alcance mínimo fora de operação • Минимальный вылет вне работы

Ausleger (m)
Jib • Flèche • Braccio
Pluma • Lança • Стрела

Außerbetriebsstellung (α°) • Out of service radius • Position hors service • Posizione fuori servizio
Posición externa de la empresa • Posição fora de operação • Положение вне работы

standard				reduced			
	α	1 (1) (m)	2 (m)		1 (1) (m)	2 (m)	
65,0	73,0°	22,0	21,5	79,4° ¹⁾	14,9	14,5	
60,0	73,0°	20,5	20,0	79,4° ¹⁾	14,0	13,5	
55,0	73,0°	18,9	18,5	79,4° ¹⁾	13,0	12,6	
50,0	73,0°	17,4	16,9	79,4° ¹⁾	12,0	11,6	
45,0	73,0°	15,9	15,4	78,0°	12,2	11,7	
40,0	72,0°	15,0	14,5	78,0°	11,1	10,7	
35,0	70,0°	14,6	14,1	74,0°	12,3	11,9	
30,0	70,0°	12,8	12,3	70,0°	-	-	

¹⁾ **Arretierung für reduzierte Außerbetriebsstellung erforderlich.** • Locking device required for reduced out of service radius. • Arrêtage requis pour la position hors service réduite.
È necessario un dispositivo di blocco per la posizione ridotta di fuori servizio. • La posición compacta fuera de servicio precisa de un dispositivo de bloqueo. • Travamento necessário para a posição reduzida fora de serviço. • Требуется фиксатор для уменьшенного положения вне работы.

Ausladung und Tragfähigkeit · Radius and capacity · Portée et charge · Sbraccio e portata Alcances y cargas · Alcance e capacidade de carga · Вылет и грузоподъемность

LM 1

1 (1)			m																				
m	m	t	15,0	17,5	20,0	22,5	25,0	27,5	30,0	32,5	35,0	37,5	40,0	42,5	45,0	47,5	50,0	52,5	55,0	57,5	60,0	62,5	65,0
65,0	4,0 – 31,6	12	12,00							11,60	10,59	9,69	8,88	8,15	7,48	6,87	6,31	5,79	5,31	4,85	4,43	4,03	3,65
60,0	4,0 – 35,5	12	12,00									11,15	10,20	9,33	8,54	7,82	7,15	6,53	5,96	5,42	4,90		
55,0	3,9 – 38,7	12	12,00											11,43	10,41	9,48	8,62	7,84	7,10	6,40			
50,0	3,8 – 40,4	12	12,00											11,04	10,01	9,05	8,15						
45,0	3,7 – 41,9	12	12,00											11,66	10,30								
40,0	3,6 – 40,0	12	12,00																				
35,0	3,5 – 35,0	12	12,00																				
30,0	3,4 – 30,0	12	12,00																				

2			m																				
m	m	t	15,0	17,5	20,0	22,5	25,0	27,5	30,0	32,5	35,0	37,5	40,0	42,5	45,0	47,5	50,0	52,5	55,0	57,5	60,0	62,5	65,0
65,0	3,7 – 21,4	18	18,00			17,05	15,17	13,57	12,20	10,99	9,94	8,99	8,15	7,38	6,68	6,04	5,45	4,90	4,40	3,92	3,48	3,06	2,75
60,0	3,6 – 18,4	24	24,00	22,02	19,40	17,27	15,44	13,87	12,50	11,29	10,21	9,25	8,37	7,57	6,83	6,16	5,53	4,95	4,40	4,00			
55,0	3,5 – 20,2	24	24,00			21,38	19,00	16,98	15,25	13,73	12,40	11,20	10,14	9,16	8,28	7,46	6,71	6,01	5,50				
50,0	3,4 – 21,3	24	24,00			22,62	20,10	17,97	16,14	14,54	13,13	11,86	10,73	9,69	8,75	7,87	7,25						
45,0	3,3 – 22,3	24	24,00			23,76	21,05	18,77	16,84	15,16	13,69	12,38	11,22	10,15	9,40								
40,0	3,2 – 23,3	24	24,00				22,09	19,69	17,66	15,92	14,40	13,04	12,10										
35,0	3,1 – 24,1	24	24,00				22,97	20,42	18,26	16,39	15,10												
30,0	3,0 – 24,5	24	24,00				23,32	20,25	18,20														

Load-Plus

1 (1)			m																				
m	m	t	15,0	17,5	20,0	22,5	25,0	27,5	30,0	32,5	35,0	37,5	40,0	42,5	45,0	47,5	50,0	52,5	55,0	57,5	60,0	62,5	65,0
65,0	4,0 – 33,7	12	12,00								11,48	10,57	9,75	9,00	8,33	7,71	7,14	6,62	6,13	5,67	5,24	4,84	4,45
60,0	4,0 – 37,9	12	12,00									11,18	10,29	9,48	8,74	8,06	7,42	6,84	6,28	5,75			
55,0	3,9 – 40,7	12	12,00										11,27	10,34	9,48	8,69	7,95	7,25					
50,0	3,8 – 42,5	12	12,00											10,92	9,93	9,00							
45,0	3,7 – 43,7	12	12,00											11,10									
40,0	3,6 – 40,0	12	12,00																				
35,0	3,5 – 35,0	12	12,00																				
30,0	3,4 – 30,0	12	12,00																				

2			m																				
m	m	t	15,0	17,5	20,0	22,5	25,0	27,5	30,0	32,5	35,0	37,5	40,0	42,5	45,0	47,5	50,0	52,5	55,0	57,5	60,0	62,5	65,0
65,0	3,7 – 22,7	18	18,00				16,21	14,56	13,14	11,89	10,80	9,82	8,94	8,15	7,42	6,76	6,15	5,58	5,06	4,56	4,10	3,67	3,35
60,0	3,6 – 19,7	24	24,00	23,64	20,92	18,68	16,77	15,14	13,71	12,45	11,33	10,32	9,40	8,57	7,80	7,10	6,45	5,84	5,26	4,85			
55,0	3,5 – 21,6	24	24,00			22,98	20,49	18,38	16,56	14,97	13,58	12,33	11,21	10,19	9,26	8,40	7,62	6,88	6,35				
50,0	3,4 – 22,8	24	24,00				21,69	19,43	17,50	15,80	14,31	12,97	11,78	10,68	9,69	8,76	8,10						
45,0	3,3 – 23,8	24	24,00				22,67	20,24	18,17	16,37	14,80	13,40	12,15	11,00	10,20								
40,0	3,2 – 24,7	24	24,00				23,66	21,06	18,86	16,98	15,33	13,87	12,85										
35,0	3,1 – 25,2	24	24,00					21,47	19,16	17,16	15,80												
30,0	3,0 – 25,5	24	24,00					21,18	18,80														